

Service Bulletin

Maintenance of Way Equipment

Date: 01/05/2021

RRP Service Bulletin No: RRP SB362

Title: Cummings Engine Door Grab Handle Kit

Rating:



ALERT
(Potential Problem)



INFORMATION
(Action Is Optional)



DIRECTIVE
(Action Is Required)



PRODUCT IMPROVEMENT
(Enhance Product)

Product Series: Dual Anchor Spreader Plate [DASP] & Advanced Tie Plate Inserter [ATPI] with Cummings 3.8 engines.

Serial No:

DASP-284	935582	CN-W	CN64094
DASP-285	935582	CN-W	CN64095
DASP-286	935582	CN-W	CN64096
DASP-287	935582	CN-W	CN64097
DASP-288	955582	CN-S	CN64090
DASP-289	945582	CN-S	CN64091

DASP-290	945582	CN-E	CN64086
DASP-291	955582	CN-E	CN64087
DASP-292	945582	CN-S	CN64088
DASP-293	945582	CN-S	CN64089
DASP-294	935582	CN-W	CN64092
DASP-295	935582	CN-W	CN64093

ATPI-019	935588	CN-W	CN43865
ATPI-020	935588	CN-W	CN43866
ATPI-021	945588	CN-S	CN43863
ATPI-022	945588	CN-S	CN43864
ATPI-030	935588	CN-W	CN43867
ATPI-031	935588	CN-W	CN43868

ATPI-018	930587
----------	--------


Summary: Engine Doors Grab Handles Kit available to make removing the engine panel easier.

Action: Install the Engine Doors Grab Handles Kit, RRP# 793099.


Completion / Resolution: Continue with normal machine operation after installing the grab handles.

Instructions

1. When engine is not running remove both side doors on the engine (for clarity only one door is shown).
2. Drill clearance holes as directed.
3. Mount Engine Doors Grab Handles Kit (RRP P/N 793099).
4. Reattach doors to engine.

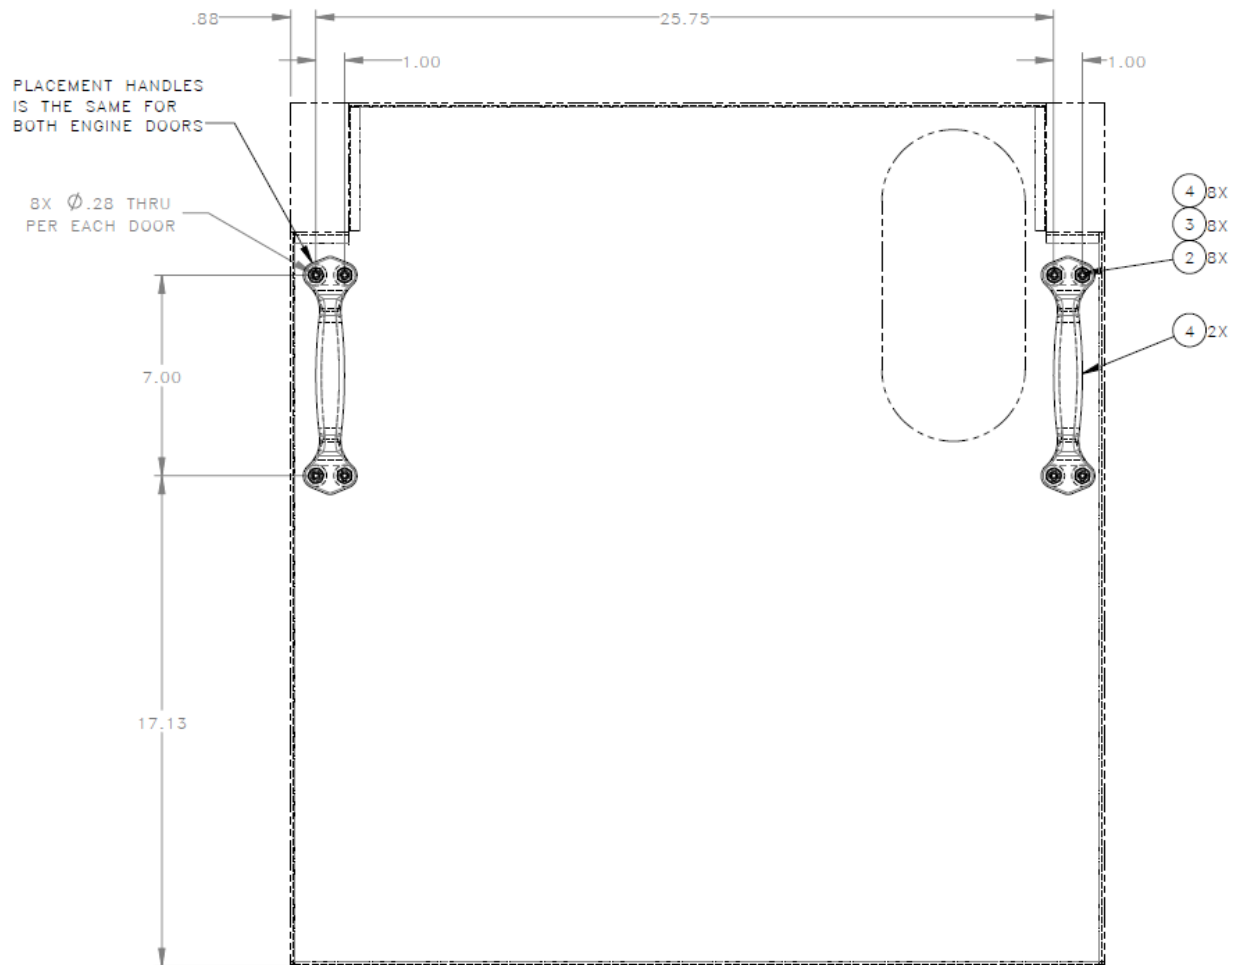

Kit, Engine Doors Grab Handle / RRP 793099 [Rev 1 (12.2020)]

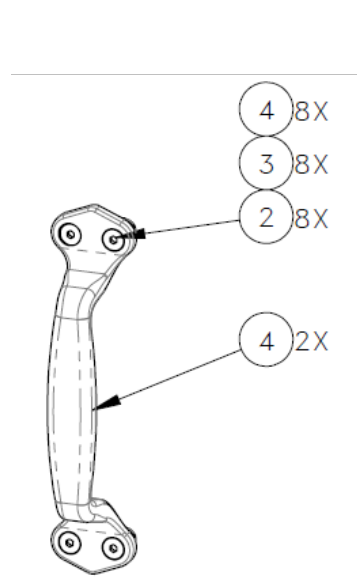

NO.	QTY	DESCRIPTION	PART NO.
1	16	SCR, SOC FLT: .25-20 X 1	400847
2	16	WASHER, FLT: .25	401619
3	16	NUT, HEX ES: .25-20 HVY	404549
4	4	HANDLE, GRAB	473046
5	1	INSTRUCTIONS, ENGINE DOORS GRAB HANDLE KIT	800345

BOM QUANTITIES RETROFITS
 BOTH ENGINE DOORS

Contact: If you have any questions or we can be of any service, please contact the Racine Railroad Products Service Department at (262)-637-9681 or fieldservice@racinerailroad.com.