
Service Bulletin

Maintenance of Way Equipment

Date: 02.07.2025

RRP Service Bulletin No: RRP SB395

Title: Anchormatic 3 (AM3) Work Arm Lock

Rating:



ALERT

(Potential Problem)



INFORMATION

(Action Is Optional)



DIRECTIVE

(Action Is Required)



PRODUCT IMPROVEMENT

(Enhance Product)

Product Series: Anchormatic 3

Serial No:

AM3-001	UPRR	AAA-2407
AM3-002	UPRR	AAA-2401
AM3-003	UPRR	AAA-2402
AM3-004	UPRR	AAA-2003

AM3-005	UPRR	AAA-2404
AM3-006	UPRR	AAA-2405
AM3-007	UPRR	AAA-2406

Summary:

Machines have experienced workarm locks stuck in the unlocked position. This can lead to the workarms falling during track travel potentially damaging the machine.


Action:

RRP is currently working on both software protections and an improved lock design. The updated software is version 6.1.10.



Contact RRP for replacement pins (no charge).

Resolution:

Operators must verify, by visual inspection, that the swing arm locks are engaged correctly before track traveling and when switching from work to travel mode.

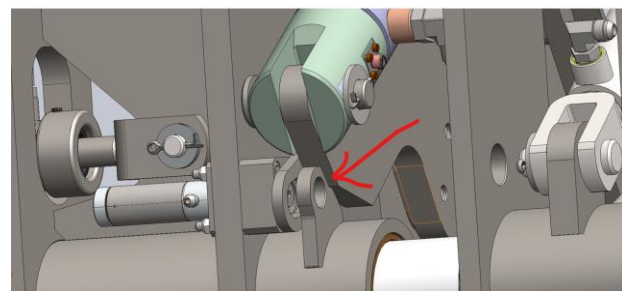

Air Locks Not Engaged

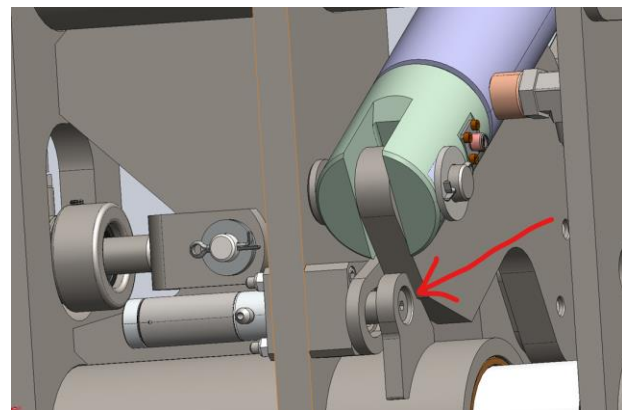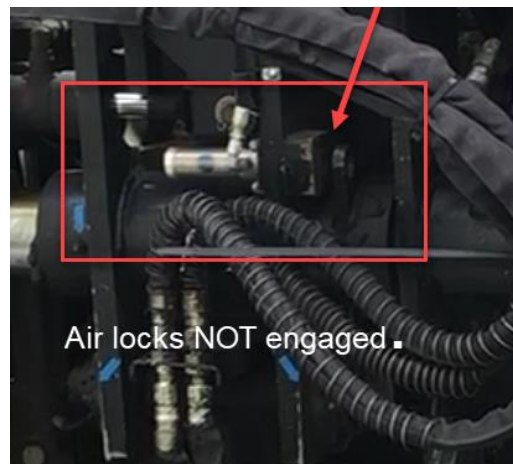

Air Locks Engaged

